



# Pro-Wedge

W/ Auto-Engage



## Operator's Manual

Revision: G

© Copyright 2024 by DEMTECH Services, Inc.

## All Rights Reserved

### Scope of Manual:

This manual contains procedures for safety, general unpacking, set-up, and operation of your DEMTECH Services, Inc. Pro-Wedge.

The text of this publication, or any part thereof, may not be reproduced or transmitted in any form or by any means, electronic or mechanical, including photocopying, recording, storage in an information retrieval system, or otherwise, without prior written permission of DEMTECH Services, Inc.

### *Notice*

Patents have been granted and/or patent applications are pending or are in the process of preparation on all DEMTECH Services, Inc. developments.

The material in the manual is for informational purposes only and is subject to change without notice.

DEMTECH Services, Inc. assumes no responsibility for any errors that may appear in this manual.

DEMTECH Services, Inc.  
6414 Capitol Avenue Diamond Springs, CA 95619 U.S.A.  
Telephone: (530) 621-3200  
Toll Free: (888) 324-9353  
Web Site: [www.demtech.com](http://www.demtech.com)

## Table of Contents

<b>1</b>	<b>SAFETY PRECAUTIONS.....</b>	<b>PAGE 1</b>
<b>2</b>	<b>GENERAL SAFETY &amp; MAINTENANCE INFORMATION.....</b>	<b>PAGE 2</b>
	2.1 Intended Use.....	Page 2
	2.2 Maintenance.....	Page 2
<b>3</b>	<b>GENERAL PRODUCT DATA.....</b>	<b>PAGE 3</b>
<b>4</b>	<b>OPERATING ENVIRONMENT.....</b>	<b>PAGE 3</b>
<b>5</b>	<b>SITE PREPARATION.....</b>	<b>PAGE 3</b>
<b>6</b>	<b>UNPACKING &amp; INSTALLATION INSTRUCTIONS.....</b>	<b>PAGE 4</b>
	6.1 Unpacking and Preparation.....	Page 4
	6.2 Electrical Plug Connection.....	Page 5
	6.3 Generator Recommendations.....	Page 5
	6.4 Accessories.....	Page 6
<b>7</b>	<b>MATERIAL SET-UP.....</b>	<b>PAGE 6</b>
	7.1 Set-up Nip Pressure Adjustment.....	Page 7
	7.2 Set-up Upper Contour Roller Configurations.....	Page 9
	7.3 Set-up Lower Contour Roller Adjustment.....	Page 13
<b>8</b>	<b>WELDING PROCEDURE.....</b>	<b>PAGE 16</b>
	8.1 Power Up.....	Page 16
	8.2 Setting Wedge Temperature.....	Page 17

8.3	Setting Weld Speed.....	Page 17
8.4	Starting a Weld.....	Page 19
8.5	Ending a Weld.....	Page 19
8.6	Shut-Down.....	Page 19
<b>9</b>	<b>REFERENCE DOCUMENTS.....</b>	<b>PAGE 20</b>
9.1	Appendix A, Pro-Wedge Welding Speed / Temperature Chart.....	Page 21
9.2	Appendix B, Pro-Wedge Speed Setting Versus Travel Rate Chart...	Page 22
9.3	Appendix C, Pro-Wedge Lid Wiring Schematic (Parts ID).....	Page 23
9.4	Pro-Wedge Lid Wiring Schematic (Parts List).....	Page 24
9.5	Appendix D, Pro-Wedge Box Wiring Schematic (Parts ID).....	Page 25
9.6	Pro-Wedge Box Wiring Schematic (Parts List).....	Page 26
9.7	Appendix E, Warranty.....	Page 27

# 1 Safety Precautions

Safety precautions for operating personnel and equipment:

**WARNING 1:** Operating personnel should perform only the procedures described and recommended in this manual. Only qualified service personnel familiar with electrical shock hazards and mechanical entanglement hazards present inside the equipment should perform disassembly or corrective maintenance of the equipment.

**WARNING 2:** To avoid shock hazards, the equipment must be grounded with an adequate earth ground in accordance with local and national electrical codes.

**WARNING 3:** The locations of potentially dangerous voltages and other hazards are identified and labeled on the equipment. Be careful to observe these warnings when installing, operating, maintaining or servicing the equipment. Observe all warnings in this manual.

**WARNING 4:** Make sure to turn off the equipment power and remove the ~ (AC) line cord from the power outlet before attempting to service the equipment. Do not perform service unless you are qualified and trained to do so.

**WARNING 5:** This product is intended for operator attended operation only. This product should never be left unattended at any time while it is plugged in and the power is turned on. Incorrect use of the product such as overheating of the material can present a fire and explosion hazard, especially near combustible materials and explosive gases.

**WARNING 6:** This product is intended for operation in dry environments only. Higher humidity environments should be kept non-condensing by avoiding large temperature swings.

**WARNING 7:** Do not touch the main housing, air nozzle and/or output molten material when they are hot as they can cause burns. After use allow sufficient time for the product to cool to room temperature before handling and stowing. Do not point or direct the hot air flow and the output molten material in the direction of personnel.

**CAUTION 1:** Observe the precautions given on the equipment and within this manual to prevent damage to the equipment.

**CAUTION 2:** Before connecting the equipment to its electrical power source, check that the ~ (AC) voltage, frequency and current to be supplied to the equipment are correct and match the serial plate affixed to the system.

**CAUTION 3:** Use proper handling and packaging procedures for Electro-Static Discharge (ESD) sensitive Printed Circuit Boards (PCB's). Assume that all PCB's are sensitive to potential damage from ESD.

**CAUTION 4:** Unauthorized personnel should not remove from the equipment those panels or covers that are provided for protection and/or require a tool to remove.

## 2 General Safety & Maintenance Information

The DEMTECH Services, Inc. Pro-Wedge Welder is a high temperature and voltage piece of equipment. Always disconnect the power source before performing any service and/or maintenance procedures on the welder. Never lift, pull or carry the welder by the power cord or electrical connection. Always maintain slack in any extension cords connected to the welder while in operation to avoid damage to the power connections. At all times while operating the welder keep hands, fingers and other body parts well clear of the heating element and related mounting components. Always use the Pro-Wedge in a well-ventilated area when welding materials such as PVC which can produce toxic fumes. Do not inhale toxic fumes when present. Do not operate near flammable materials of any kind. Do not apply flammable materials, including liquids, to seam area. Allow welder to cool to room temperature, at least 15 minutes, before returning to the shipping/storage case. Protect welder from exposure to rain or standing water. Never attempt to weld in standing water.

### 2.1 *Intended Use*

For additional product information please refer to the product data sheet located in *Appendix C* of this manual.

The Pro-Wedge has been manufactured according to the latest technology and current safety regulations. However, improper use or abuse may lead to hazardous conditions for the user or third party or damage to the unit.

Always have this manual handy at the location where the Pro-Wedge is being used so that it can be referred to quickly and easily.

The technician assigned to operate this welder must have read through and become familiar with this manual before starting work, particularly the section on safety.

Do not make changes or modifications to the Pro-Wedge relative to safety without contacting the manufacturer for advice.

### 2.2 *Maintenance*

Maintenance, inspection and adjustment of the Pro-Wedge shall only be carried out by qualified personnel. Before removing or installing spare parts or performing other repair operations to the welder, consult DEMTECH Services, Inc. or your authorized DEMTECH service center for advice on proper procedures. This will help insure a safe and successful outcome. Always make sure all screw connections are tight before attempting to operate the welder after maintenance and/or repair procedures. Also make sure all covers, guards, and other safety devices have been fully reinstalled before use.

### 3 General Product Data

The DEMTECH Services, Inc. Pro-Wedge Geo-Membrane Wedge Welder, hereinafter referred to as the Pro-Wedge or welder, dramatically speeds the welding of plastic sheet materials through the use of its wedge heating elements and multiple pressure roller design. These features combined with state-of-the-art electrical and electronics controls and an easy to use User Interface (UI) makes performing welding tasks very efficient. The semi-automated operation of the welder eliminates cumbersome setup and speeds up processing time while providing a very rugged and reliable welder. The enclosed controller sub-system is easy to maintain. You can be assured the Pro-Wedge has been built using the highest quality materials available which include Billet Aluminum and ground and hardened steel. DEMTECH Services, Inc. strives to make our welders easy to use and built to last. Just like all other DEMTECH Services, Inc. products, even a first time user will be productive in minutes.

### 4 Operating Environment

The Pro-Wedge is intended to be operated within the following environmental ranges and conditions. Operating the welder in environments which are less than or greater than the nominal values listed can adversely affect performance.

Temperature .....+32 to +100° Fahrenheit (F); 74° F Nominal  
 .....(+0 to +38° Centigrade (C); 23°C Nominal)

Humidity .....0 to 90% (non-condensing); 45% Nominal

Elevation .....0 to 7,000 Feet; 2,000 Feet Nom  
 .....(0 to 2,134 meters; 610 meters Nominal)

### 5 Site Preparation

Before proceeding with the unpacking and installation instructions in the following section(s) make sure the work site is prepared and ready to use the Pro-Wedge. You should have an adequate power source capable of providing clean Alternating Current (AC) power at 110 or 220 Volts at the rated current. Refer to the serial plate (P/N 100-399) affixed to the back side of your welder for the voltage and current requirements. The install and use area should be clean, dry and free of debris and provide adequate working area to allow efficient and effective use of the welder.

## 6 Unpacking & Installation Instructions

This section contains instructions for the unpacking, placement and installation of the Pro-Wedge. Carefully review the following information, sub-sections and each procedure before beginning unpacking and installation of the welder.

The Pro-Wedge comes complete in a sturdy, reusable, portable shipping/storage case. The custom foam inserts protect the welder from damage during shipping and storage and should always be left inside the case. When the welder is out of the case, make sure to keep the lid closed to avoid dirt, dust, debris and/or water from getting inside. The welder must be removed from the case and placed onto the work site for use. When not in use, the Pro-Wedge should always be stored in the shipping/storage case to protect it from the elements and potential damage.

**Note: The welder illustrated in this manual shows ALL available features for the Pro-Wedge, therefore, your welder may vary slightly in appearance from that depicted.**

### 6.1 Unpacking and Preparation

- a. Before opening the shipping/storage case for the first time and unpacking the welder, inspect the outside of the case thoroughly for any signs of mishandling or damage during shipping. Report any damage to the shipping carrier immediately and **do not proceed with unpacking**. You should consult your administration concerning claims for shipping damage. Please notify DEMTECH Services, Inc. or your authorized DEMTECH distributor where the product was purchased in the event of any shipping damage.
- b. Unlatch and open the shipping/storage case lid and inspect inside the case and the welder thoroughly for any signs of mishandling or damage during shipping. Report any damage to the shipping carrier immediately and **do not proceed with unpacking**. You should consult your administration concerning claims for shipping damage. Please notify DEMTECH Services, Inc. or your authorized DEMTECH distributor where the product was purchased in the event of any shipping damage.
- c. Make note of the orientation of the welder and packing foam inserts inside the shipping case to facilitate repackaging the welder after use.
- d. To avoid injury to personnel and/or damage to the welder, be sure to use adequate care when lifting and removing or lowering and replacing the welder into the shipping/storage case.



- e. The welder must be removed from the shipping/storage case and placed in an appropriate location suitable for the welding you intend to perform.

## 6.2 *Electrical Plug Connection*

The Pro-Wedge is supplied with an appropriate U.S. plug-end according to the specified operating voltage of the welder. The supplied plug-end can be replaced by the customer as long as the new one is rated at a minimum of 20 amps.

**This procedure should only be performed by a qualified electrician.**

### Electrical Extension Cords

Extension cords should be at least 12 gauge and regardless of overall length should have a minimum of 3 plug-end connections.

<b>Conductor Size</b>	<u>3-Wire</u> 10 AWG (5.3 mm <sup>2</sup> )	<u>3-Wire</u> 12 AWG (3.3 mm <sup>2</sup> )
<b>Length</b>	500 Feet (152 meters)	250 Feet (76 meters)

**Table 6.2 Maximum recommended extension cord lengths.**

## 6.3 *Generator Recommendations*

When operating the Pro-Wedge using house power from a building circuit use the appropriate plug and power cord configuration. When in-field generators are used they must be rated for a minimum of 5,000 watts, however a rating of 6,500 watts or more is highly recommended in order to obtain the best welder performance and temperature control. As a rule, higher wattage generators provide better welder performance. Keep in mind that the length and wire gauge of any extension cord being used combined with the capacity of the generator ultimately determines the operating voltage and therefore welder performance.

## 6.4 Accessories

The Pro-Wedge has been designed to weld a wide range of materials on most sub grade types. However, for the best results on each job site, there are many different accessories available to help make the welding process easier. For example, the independent front travel rollers can be replaced with a wide tubular roller to help prevent sand and loose dirt from pushing up onto the bottom sheet of material. For extreme cases of sandy sub grades, an outrigger system and raised rear travel roller are available. Please contact supplier for more information and pricing.

## 7 Material Set-up

The Pro-Wedge is designed to weld a wide range of material types and thickness' from very thin PE, PP and PVC to very thick materials such as 60-120 Mil (1.5-2.5mm) HDPE. Non-woven geotextiles can also be welded at very high speeds (up to 32 ft/minute with stock motor). The Pro-Wedge uses a spring-loaded upper contour roller system and "floating" wedge design that allows the operator to weld several different thicknesses of material without resetting the adjustments. However, for best results on all materials, the following set-up procedure can be used.

**Note: before you begin, you will need the following items to set-up a Pro-Wedge hot wedge welder:**

1. Adjust material using the material set up template as seen in Figure 7.1 (P/N 100-160T). Trace the template on a piece of the material you will be welding, cut it out and write the word "Top" on your adjustment material at the same location that it appears on the template. Fold adjustment material so that the word "top" is visible.
2. Set of metric Allen wrenches.
3. 13mm open end wrench.
4. Phillips screw driver.




**Figure 7.1**

### ***7.1 Set-up Nip Pressure Adjustment***

Adjustment Location:

The nip pressure adjustment is located between the nip lever and upper nip arm; it is a hex shaped turnbuckle style nut (#11, Figure 7.2).


The correct amount of nip pressure is needed to get a good weld. It is also important that the nip rollers are providing enough traction to keep the Pro-Wedge from “burning out”. This can happen when the nip rollers lose traction and spin on the material, causing the Pro-Wedge to stop in the seam and burn a hole in the material.

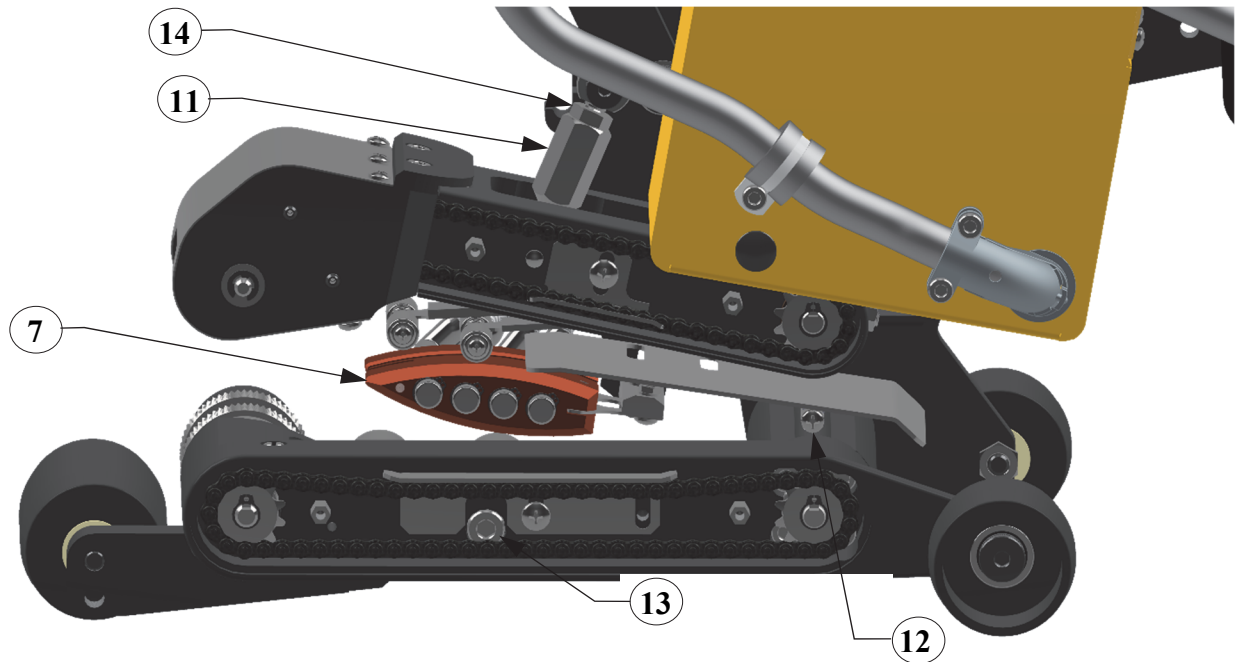

**Figure 7.2**

- 7.1.1 Make sure the heating wedge (#7, Figure 7.2) is in the disengaged position.
- 7.1.2 Loosen the top hex nut (#14, Figure 7.2). Turn the nip pressure adjustment hex nut (#11, Figure 7.2) clockwise while looking down from above several turns, raising the nip arm up to give a fresh starting point for this adjustment. Tighten the top hex nut (#14, Figure 7.2) up against the nip pressure adjustment hex nut (#11, Figure 7.2).
- 7.1.3 Place one end (one thickness) of your adjustment material between the nip rollers and into the unit about 1" inch. Engage nip rollers by pushing down on the nip lever until it has "clicked" into place. At this point the material should move around freely between the nip rollers.
- 7.1.4 Turn the hex nut (#11, Figure 7.2) counter clockwise until the nip rollers begin to pinch down on the material and you cannot turn the nut by hand anymore. This zeroes the adjustment.
- 7.1.5 Disengage nip rollers and turn the hex nut counter clockwise one full rotation.
- 7.1.6 Insert the adjustment material (the opposite end of the fold, two thicknesses) between the nip rollers and engage nip rollers together until the upper nip arm locks into place (Figure 7.3). Check pressure by attempting to move the material side to side. If you are able to move the material or pull the material straight out without the nip rollers turning, disengage the nip pressure and turn adjustment nut

(#11, Figure 7.2) counter clockwise  $\frac{1}{4}$  turn at a time until the desired pressure is reached. Remember to tighten the lock nut (#14, Figure 7.2) after you have completed adjustment of the nip pressure to prevent the pressure from backing off while welding.

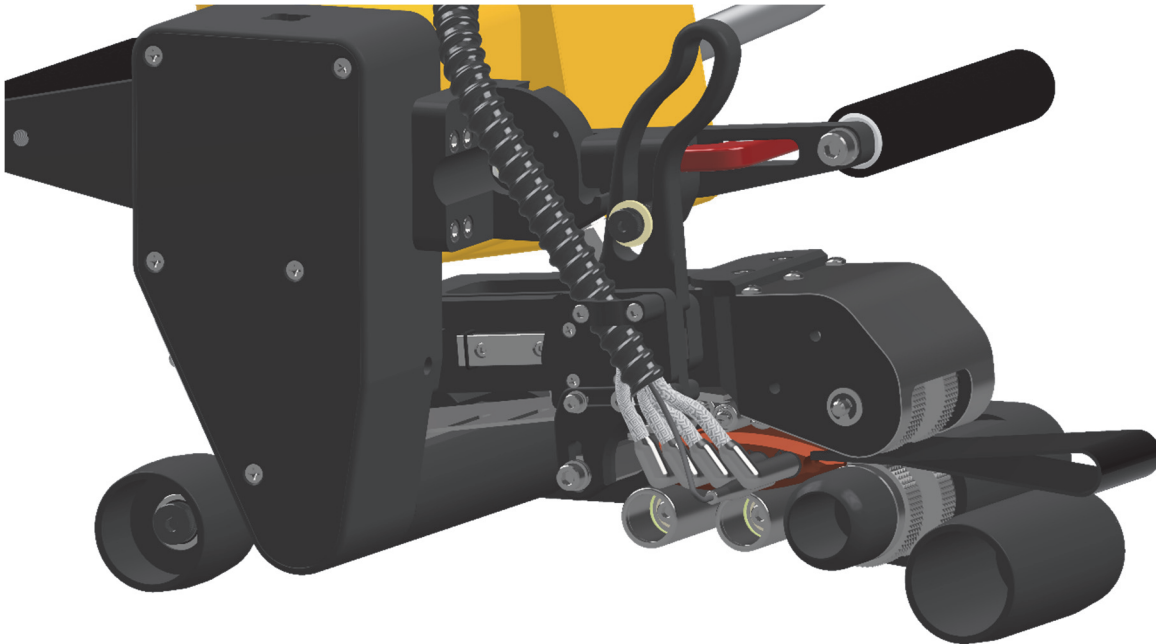

**Figure 7.3**

**Note:** When the nip pressure adjustment is set correctly, engaging the nip pressure lever should take some effort but it should feel like a smooth motion. Again, it is important that you are getting enough traction to avoid burning out and at the same time providing enough nip pressure to create a good weld. Keep in mind that the thicker the material being welded and especially textured material, the greater the pressure should be.

## **7.2 Set-up Upper Contour Roller Configurations:**

**You can skip this step and proceed to section 7.3 on page 12 if the spring/roller configuration is already correct for the material you will be welding.**

**For specific applications of the material you will be welding refer to the Upper Contour Roller Assembly Spring Configuration Chart on the following page.**

**Refer to Figure 7.4 for an example of an upper contour roller assembly recommended for HDPE welding.**

**Location:**

The upper contour roller assembly is located above the heating wedge and is fixed to the bottom of the nip arm assembly. Adding or removing the flat leaf springs will increase or decrease the upper contour roller tension. For materials not shown on chart, contact DEMTECH for recommendation.

**Note:** There are two types of springs, one that the roller axle mounts to and one that is used as a stiffener or “back up spring”. There are also two mounting locations on the mount plate (#3, Figure 7.4), one for the rear roller set (closest to the nip rollers) and one for the front roller set (furthest from the nip rollers).

**Upper Contour Roller Assembly Spring Configuration Chart:**

<b>Material</b>	<b>Thickness</b>	<b>Rear Set Installed</b>	<b>Front Set Installed</b>
HDPE/LLDPE	40-120 mil	Yes w/two backup springs	Yes w/one backup spring
HDPE/LLDPE	20-30 mil	Yes w/one backup spring	No
PP Non-Reinforced	20-40 mil	Yes w/no backup spring	No
PP Reinforced	30-45 mil	Yes w/no backup spring	Yes w/no backup spring
PVC	50-100 mil	Yes w/no backup spring	No
PVC	20-40 mil	Yes (light spring# 100-012A)	No
Geotextiles	4-50 oz. / sq. yd.	Contact Manufacturer	Contact Manufacturer

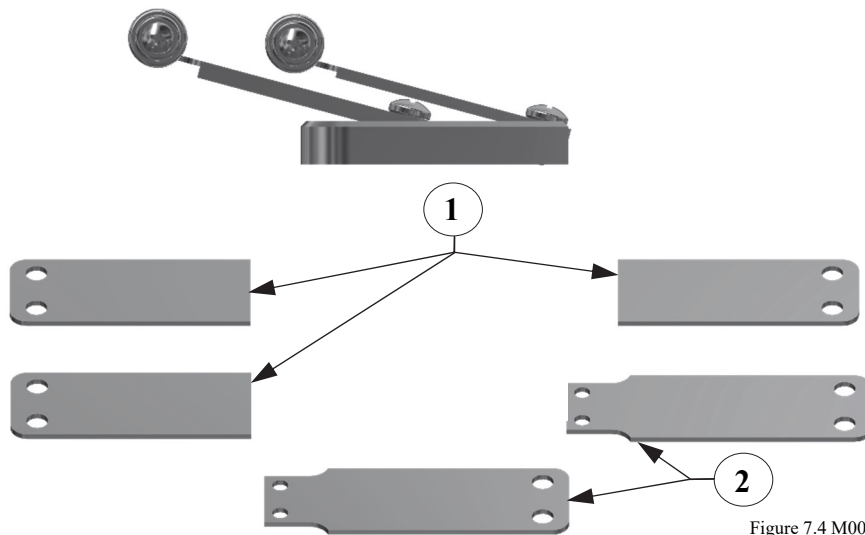


Figure 7.4 M001


### Figure 7.4

Figure 4 shows the triple / double assembly configuration for welding 40-120 mil (1.0-2.5mm) HDPE / LLDPE material. For reference Item 1 is (P/N 100-010), Item 2 is (P/N 100-012), (P/N 100-012A is light version).

#### ***Changing spring configuration:***

##### **Removing-upper contour roller assembly:**

- 7.2.1 Remove screw from the end of the shaft that the material guide plate (#12, Figure 7.2) pivots on, then slide material guide off of shaft and set aside.
- 7.2.2 Remove the two Phillips head screws that attach the upper contour roller assembly mount plate (#1, Figure 7.5) to the nip arm and remove contour assembly from the unit. You may need to move the heating wedge fore or aft for access with screwdriver.

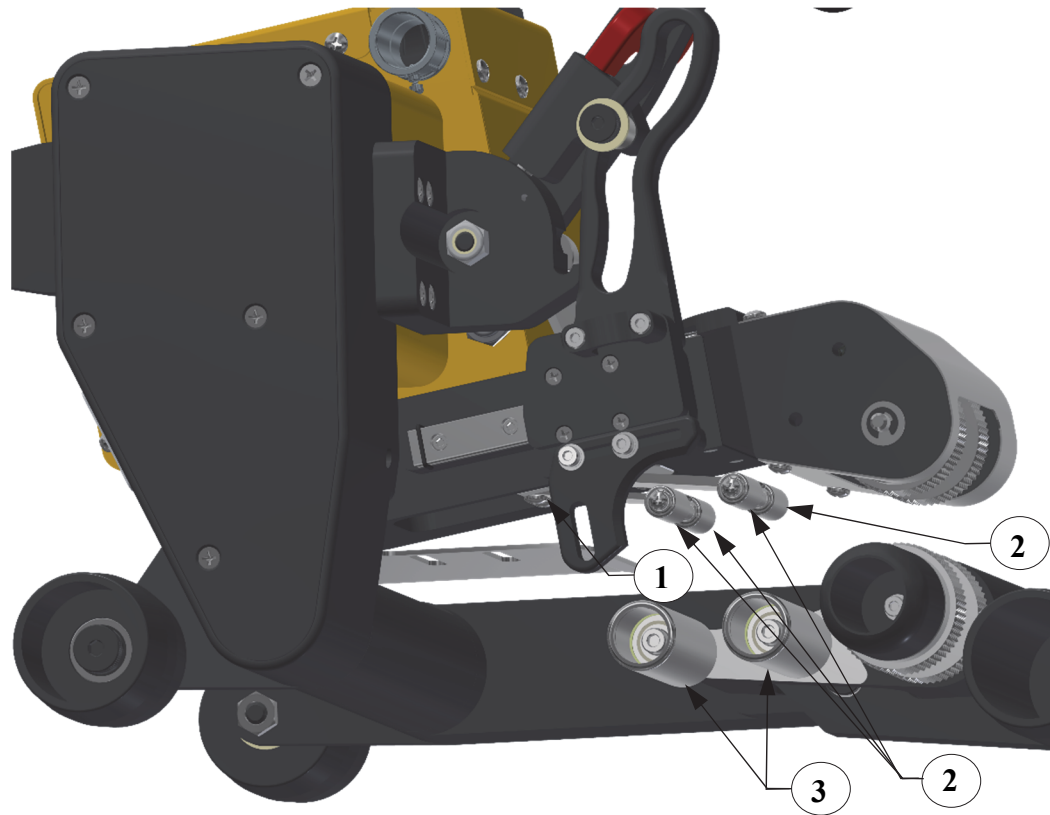

**Figure 7.5**


The individual upper contour rollers and springs can now be configured to match the material you will be welding. See the Upper Contour Roller Assembly Spring Configuration Chart on the previous page.



### 7.3 Set-up Lower Contour Roller Adjustment

Location:

The lower contour rollers (#3 and #4, Figure 7.6) are located below the heating wedge and are mounted to the lower frame directly in front of the lower nip roller (#2 Figure 7.6). For the adjustment you will need a 13mm open ended wrench and a 4mm and 6mm allen wrench.

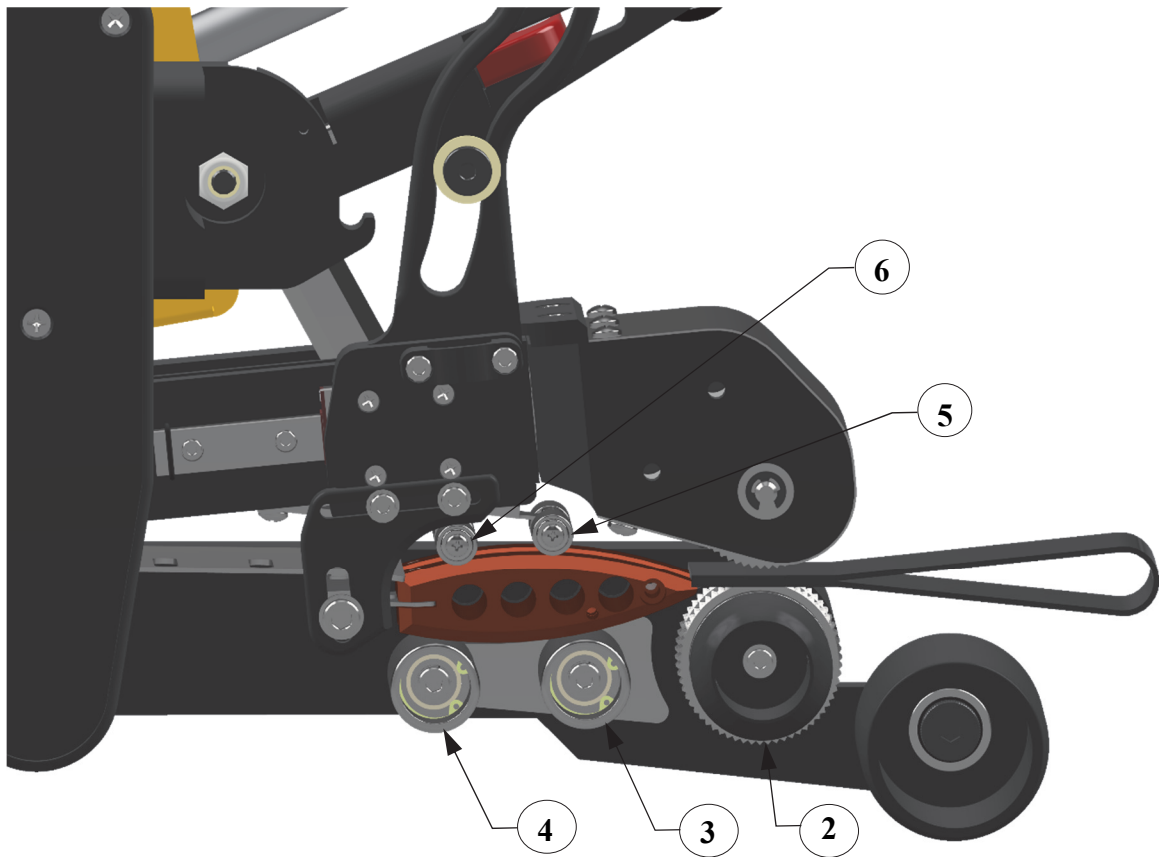

**Figure 7.6**

- 7.3.1 With the nip pressure lever in the up position and the wedge in the disengaged position, insert the adjustment material that you cut earlier from the template into the Pro-Wedge as shown in Figure 7.6 above:

Make sure the word “Top” is facing up then slide the material above and below the wedge and between the upper and lower contour rollers as shown above. Insert just enough in so that about 2 ¾” (70mm) of material is protruding out of the nip rollers

from the point where the nip rollers pinch down on the material. Slide the wedge to its engaged position until it locks into its detent. Then lock the nip pressure lever down on to the material.

**Note 1:** Make sure if using a split wedge with an air channel pin, **that the notch is cut in the end of the doubled-up piece of material** as it is detailed on the material template. This is to allow clearance for the air channel finger when the material set-up piece is in place.

- 7.3.2 With a Phillips screw driver remove lower frame chain cover to expose the lockdown bolt for the front lower contour roller (#4, Figure 7.6).
- 7.3.3 Using a 6mm Allen wrench, loosen the lockdown bolt and then temporarily adjust the front lower contour roller down, clockwise, away from the wedge using a 4mm Allen wrench on the end of the roller (this will give you a fresh starting point and you will make a final adjustment on this roller later).
- 7.3.4 Using a 13mm open end wrench, loosen the lockdown bolt (hex head) for the rear lower contour roller (#3, Figure 6). You can now adjust the height of the wedge by adjusting the rear lower contour roller up or down with a 4mm Allen wrench at the end of the roller. Once the desired position has been achieved, tighten the lockdown bolt (hex head) then check the adjustment again to make sure it did not move when tightened.

**Note 2:** The most important adjustment is the positioning of the wedge in relationship to the lower nip roller (#2, Figure 6). The distance between the lower tip of the heating wedge and the lower nip roller should be slightly more than the thickness of the material you will be welding. The distance is set by adjusting the rear lower contour roller (#3, Figure 6) up or down.

**Note 3:** When adjusting the lower contour rollers (#4) and (#3) rotate them both to the right (counterclockwise) and up so that in their adjusted positions the rollers are closest to the nip roller (#2). Also because the rear contour roller (#3) is forcing the wedge up against the upper contour roller spring tension, you may notice the roller will still spin with your fingers. This is normal. The amount of resistance of the roller when turning it with your fingers does not matter.

**Note 4:** The lower contour rollers are mounted to the lower frame on eccentric cams that thread onto the lockdown bolts. When adjusting, you may need to work the 4mm Allen wrench and the 6mm Allen wrench for the front contour roller (4)) or the 13mm open end wrench for the rear contour roller (3)) simultaneously to rotate the roller smoothly.

**Warning!** If the rear lower contour roller is adjusted too high, there will not be enough clearance for the top sheet to travel through the welder and it will be pinched between the top of the heating wedge and the upper nip frame. This will result in loss of welding nip pressure and an inconsistent weld.


7.3.5 Adjust the front lower contour roller (#4, Figure 7.6) up and to the right (counterclockwise) until it just comes in contact with the material. The roller should have a slight amount of resistance as you rotate it. If you adjust it to tight it will rock the wedge and change the rear roller (#3) adjustment.

**Note 5:** If you are setting up the Pro-Wedge to weld thin material or in very hot ambient conditions the front contour roller (#4) adjustment should be set very loose or backed off completely to reduce material dwell time (over heating material) and minimize the possibility of burn outs.

#### 7.3.6 Step 4: Set-up Wedge Fore/Aft Adjustment

The fore/aft adjustment sets the limit of travel of the heating wedge in its fully engaged position. In other words, how close the tip of the wedge is to the nip rollers. If the tip of the wedge is too close to the nip rollers they will pinch down on the wedge when pressure is engaged, reducing the amount of nip pressure on the heated material. This can also cause damage to the tip of the wedge when running out of the end of the seam.

The Auto-Engage Bracket (P/N 100-200AU/A) shown below provides the ability to adjust the heating wedge position in relation to the nip-rollers. See below for more details.

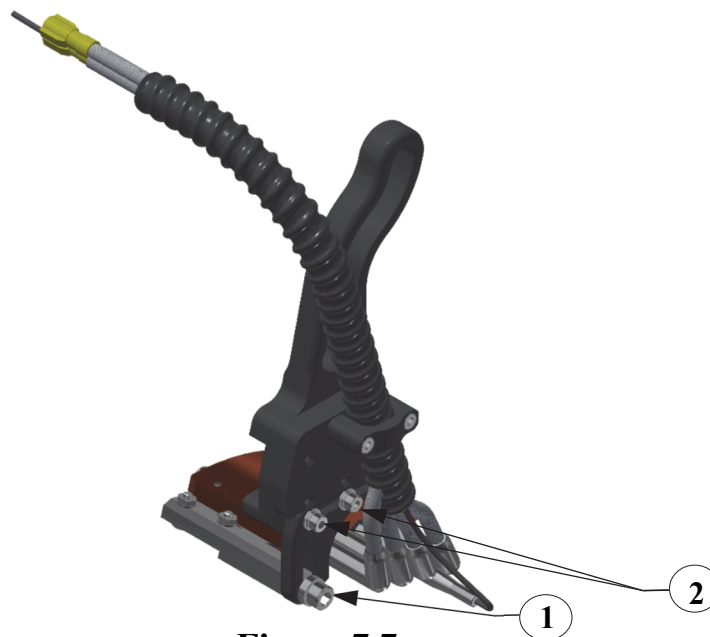

**Figure 7.7**

### **Adjustment procedures for Auto-Engage bracket (Figure 7.7):**

- 7.3.7 With material set-up piece in place and with nip lever and wedge engaged as shown on Figure 7.6, use a 5mm Allen wrench to loosen the wedge mount bolt that connects the wedge hex mount to the lock mount (#1, Figure 7.7). For HDPE set-up, position lock bolt as far down in slot as possible and tighten bolt.
- 7.3.8 Using a 3mm Allen wrench, loosen the two lock screws (#2, Figure 7.7) that hold the lower wedge slide to the auto-engage bracket. You will need to insert the 3mm Allen wrench between the cartridge heater lead wires to access one of the screws.
- 7.3.9 Move the heating wedge forward or backward (left or right) so that there is plenty of clearance between the tip of the wedge and the upper and lower nip rollers. When adjusting Pro-Wedge for welding HDPE the tip of the wedge should have the same clearance as shown in Figure 6.
- 7.3.10 Tighten lock screws to set adjustment. Re-check all adjustments to make sure they are correct before disengaging nip lever and wedge and removing material setup piece.

## **8 Welding Procedure**

### **8.1 Power Up**

Connect the Pro-Wedge power cord to power source making sure that the voltage is correct for the model of welder you have. Please refer to Sections 6.2, 6.3, and 6.4 on pages 4 - 6 of this manual for details.

Flip the main power toggle switch (#4, Figure 8.1) to the “on” position (up). The main power switch is located on the front of the control box, below the front handle. After a 3 second delay, the temperature control unit (#1, Figure 8.1) located on top of the control box should light up and display current wedge temperature.

Turn on the drive motor with the motor switch (#3, Figure 8.1), located on rear of the control box, near the nip pressure adjustment hex nut. It is recommended that the drive motor remain on at all times while the welder is plugged in. This helps to eliminate hot spots on the nip rollers and makes starting a weld quicker and easier.

## ***8.2 Setting Wedge Temperature***

### **8.2.1 Watlow EZ-Zone Controller (4 button style)**

The EZ-Zone temperature controller has a dual display. The current wedge temperature set point is displayed on the right side of the display. The actual wedge temperature is displayed on the left side of the display. To adjust the wedge temperature set point, press the up arrow button to increase the set point or the down arrow button to decrease the set point. **(Refer to the Welding Speed/Temperature Chart, Appendix A, for recommended wedge temperature settings).**

## ***8.3 Setting Weld Speed***

To set weld speed, use “+” and “-“ buttons on speed setting pot (#2, Figure 8.1) located on top of control box, next to temperature control unit. Keep in mind that the three-digit number on the speed setting pot does not relate directly to feet or meters per minute. **(Refer to the Speed Setting versus Actual Travel Rate Chart, Appendix B, for setting versus feet per minute values).**

**Note on High/Low Gear:** Unless otherwise specified, your Pro-Wedge has been factory set in low gear, which gives the welder a speed range of 0-18 feet per minute (0-5.5 meters/min). You will use this range for most all in-field geomembrane welding applications and especially ones that require high torque such as HDPE. The main motor drive sprockets on the Pro-Wedge can be flipped to change the ratio to high gear, changing the speed range to 0-32 ft/min (0-9.5 meters/min) for high speed seaming of thin materials and non-woven geotextiles. Speed versus setting values are listed for high and low gear in the speed-setting chart in Appendix B.

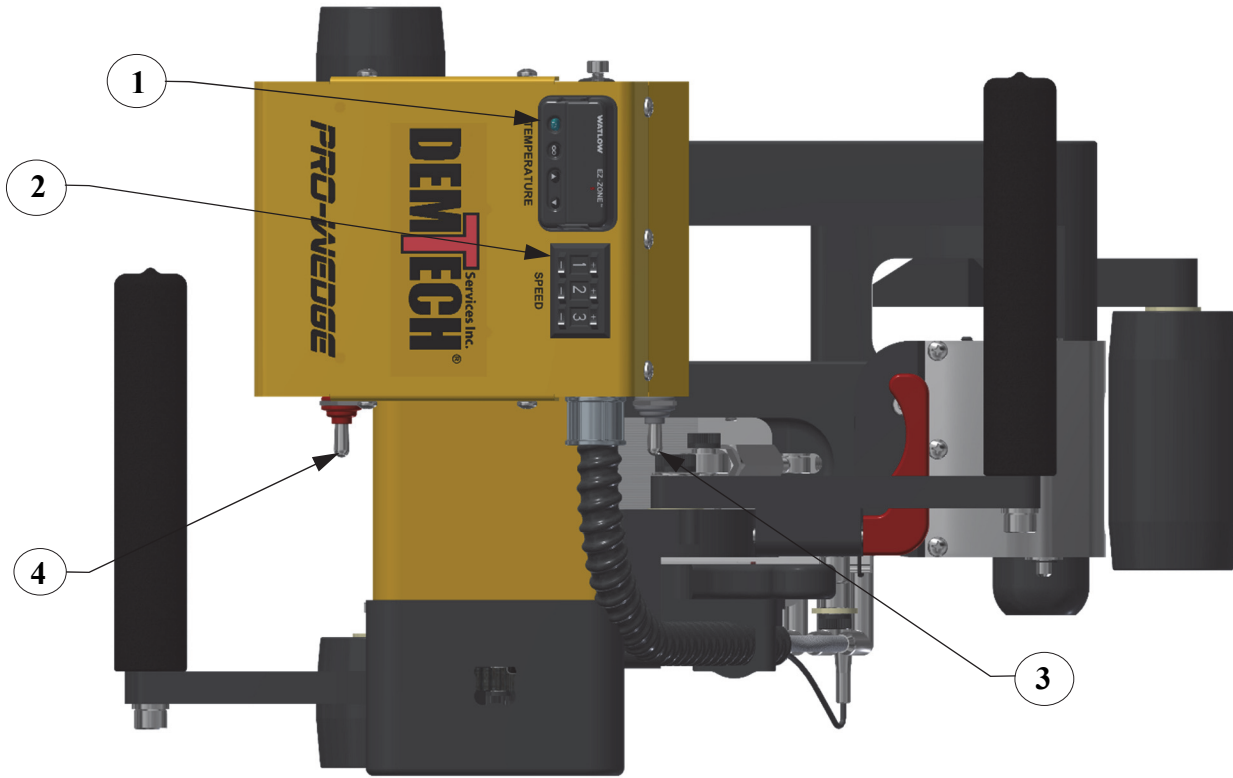


Figure 8.1

## **8.4 Starting a Weld**

To start a weld, you must first make sure that the material to be welded is set at the proper overlap. The optimum overlap is 5-6 inches (12.7-15.2 cm) for field welds. For recommendation on in-house fabrication overlap settings, please contact the manufacturer.

Start the loading process with the nip lever in the “up” or disengaged position, the heating wedge in the “forward” or disengaged position (Figure 7.5), and the motor on with the nip rollers turning.

**First**, peel back the top sheet to expose the bottom sheet. Load bottom sheet of the material into welder, between both lower contour rollers and the bottom of heating wedge, then between the two nip rollers.

**Second**, insert the top sheet into the welder, between the upper contour roller(s) and the top of the heating wedge, and then between the nip rollers. You may need to roll the welder forward and backward a little for both sheets to settle into the welder.

**Third**, pull out on the wedge lock handle and slide wedge toward nip rollers until the lock pin slides off the end on the slide rail. Make sure wedge is completely engaged before continuing.

**Fourth**, engage nip rollers by pushing the nip pressure lever down until it “clicks” and is locked in position. At this time the welder should be moving and welding on its own. If the nip rollers are spinning on the material and burning a hole, quickly disengage nip rollers, roll the welder down the seam a few more inches, past the overheated area, and engage again.

## **8.5 Ending a Weld**

Just as the welder is about to run out of the end of the seam, disengage nip rollers, slide welder out of the seam, and then disengage wedge. At this time it is a good idea to tip the Pro-Wedge up onto the front handle, raising the back of the unit, to prevent a hole being melted in the material from heat radiating from the wedge.

## **8.6 Shut-Down**

To shut down the Pro-Wedge, simply turn main power switch to the “off” position or unplug unit. After 5-10 minutes, place unit in shipping/storage case provided with welder.

## 9 Reference Documents

### *Appendix A, Welding Speed / Temperature Chart*

Refer to Appendix A for recommended preliminary speeds and temperatures for a wide range of material types and thicknesses. This chart is a great reference tool, however all site conditions are different and the settings recommended on the chart may not be suitable for your specific site. Please contact a DEMTECH technical representative for advice on appropriate settings.

### *Appendix B, Speed Setting versus Actual Travel Rate Chart*

Refer to Appendix B for a chart showing the travel (welding) speed of the Pro-Wedge at various speed pot settings. Keep in mind that actual speed, especially at the highest setting (999) may vary depending on power supply, length of cords, etc.

### *Appendix C & D, Pro-Wedge Box & Lid Wiring Schematics*

Refer to Appendix C & D for both box and lid Wiring Schematics.

### *Appendix E, Pro-Wedge Product Warranty*

Refer to Appendix E for the Pro-Wedge Product Warranty.



### 9.1 Appendix A, Pro-Wedge Welding Speed / Temperature Chart

Material Type	Thickness mil (mm)	Ambient Temperature	Wedge Temperature	Maximum Welding Speed ft/min (m/min)	Solid Wedge	Split Wedge	Solid Nips	Split Nips	Upper contour rollers
HDPE	12 (0.3)	65-85 F (18-30 C)	650 F (340 C)	32 (9.8)		X	rubber		single light
HDPE	20 (0.5)	65-85 F (18-30 C)	750 F (400 C)	25 (7.6)		X	rubber		single upper
HDPE	30 (0.75)	65-85 F (18-30 C)	750 F (400 C)	18 (5.5)		X	rubber		single upper
HDPE	40 (1.0)	65-85 F (18-30 C)	750 F (400 C)	16 (4.9)		X		steel	double/triple
HDPE	60 (1.5)	65-85 F (18-30 C)	860 F (460 C)	15 (4.6)		X		steel	double /triple
HDPE	80 (2.0)	65-85 F (18-30 C)	860 F (460 C)	13 (4.0)		X		steel	double/triple
HDPE	100 (2.5)	65-85 F (18-30 C)	860 F (460 C)	12 (3.7)		X		steel	double/triple
HDPE	120 (3.0)	65-85 F (18-30 C)	860 F (460 C)	8 (2.4)		X		steel	double/triple
LLDPE	20 (0.5)	65-85 F (18-30 C)	600 F (315 C)	25 (7.6)		X	rubber		single upper
LLDPE	30 (0.75)	65-85 F (18-30 C)	650 F (340 C)	22 (6.7)		X	rubber		single upper
LLDPE	40 (1.0)	65-85 F (18-30 C)	750 F (400 C)	20 (6.1)		X		steel	single/double
LLDPE	60 (1.5)	65-85 F (18-30 C)	800 F (425 C)	18 (5.5)		X		steel	double/triple
LLDPE	80 (2.0)	65-85 F (18-30 C)	860 F (460 C)	15 (4.6)		X		steel	double/triple
Non-reinforced PVC/PP	20 (0.5)	65-85 F (18-30 C)	650 F (340 C)	25 (7.6)	X	X	rubber		single upper
Non-reinforced PVC/PP	30 (0.75)	65-85 F (18-30 C)	700 F (370 C)	22 (6.7)	X	X	rubber		single upper
Non-reinforced PVC/PP	40 (1.0)	65-85 F (18-30 C)	750 F (400 C)	20 (6.1)	X	X	rubber		single/double
Non-reinforced PVC/PP	50-60	65-85 F (18-30 C)	800 F (425 C)	18 (5.5)	X	X	steel	steel	double/triple
Non-reinforced PVC/PP	80 (2.0)	65-85 F (18-30 C)	860 F (460 C)	15 (4.6)	X	X	steel	steel	double/triple
Reinforced PP	36 (0.9)	65-85 F (18-30 C)	750 F (400 C)	32 (9.8)	X		steel		single/single
Reinforced PP	45 (1.1)	65-85 F (18-30 C)	750 F (400 C)	32 (9.8)	X		steel		single/single
	<b>Weight oz. / sq. yd.</b>								
Non-woven geotextile	4 to 8	65-85 F (18-30 C)	650 F (340 C)	32 (9.8)	X	X	steel	steel	wedge
Non-woven geotextile	10 to 12	65-85 F (18-30 C)	650 F (340 C)	32 (9.8)	X	X	steel	steel	wedge
Non-woven geotextile	14 to 20	65-85 F (18-30 C)	650 F (340 C)	25 (7.6)	X	X	steel	steel	wedge
Non-woven geotextile	22 to 32	65-85 F (18-30 C)	650 F (340 C)	22 (6.7)	X	X	steel	steel	wedge
Non-woven geotextile	Up to 50	65-85 F (18-30 C)	650 F (340 C)	18 (5.5)	X	X	steel	steel	wedge
<p><b>NOTE: The above parameters are intended as a basic starting point only and will need to be adjusted to compensate for each individual ambient and site condition.</b></p> <p><b>Manufacturer assumes no liability for weld quality using the above parameters!!</b></p>									

## 9.2 Appendix B, Pro-Wedge Speed Setting Versus Travel Rate Chart

### Speed setting versus actual travel speed (FEET PER MINUTE)

Setting	Low Gear	High Gear
999	18	32
950	16	29
900	15	27.5
850	14	26
800	13	24.5
750	12.5	22.5
700	12	21
650	11	19.5
600	10	18
550	9.5	16.5
500	8.5	15
450	8	13.5
400	7	12
350	6	10.5
300	5.5	9
250	4.5	7.5
200	3	6
150	2	4
100	1	3

Setting	Low Gear	High Gear
999	18	32
950	16	29
900	15	27.5
850	14	26
800	13	24.5
750	12.5	22.5
700	12	21
650	11	19.5
600	10	18
550	9.5	16.5
500	8.5	15
450	8	13.5
400	7	12
350	6	10.5
300	5.5	9
250	4.5	7.5
200	3	6
150	2	4
100	1	3


Setting	Low Gear	High Gear
999	18	32
950	16	29
900	15	27.5
850	14	26
800	13	24.5
750	12.5	22.5
700	12	21
650	11	19.5
600	10	18
550	9.5	16.5
500	8.5	15
450	8	13.5
400	7	12
350	6	10.5
300	5.5	9
250	4.5	7.5
200	3	6
150	2	4
100	1	3

### Speed setting versus actual travel speed (METERS PER MINUTE)

Setting	Low Gear	High Gear
999	5.4	9.6
950	4.8	8.8
900	4.5	8.3
850	4.2	7.9
800	3.9	7.4
750	3.8	6.8
700	3.6	6.4
650	3.3	5.9
600	3	4.5
550	2.9	5
500	2.6	4.5
450	2.4	4
400	2.1	3.6
350	1.8	3.1
300	1.7	2.7
250	1.4	2.3
200	0.9	1.8
150	0.6	1.2
100	0.3	0.9

Setting	Low Gear	High Gear
999	5.4	9.6
950	4.8	8.8
900	4.5	8.3
850	4.2	7.9
800	3.9	7.4
750	3.8	6.8
700	3.6	6.4
650	3.3	5.9
600	3	4.5
550	2.9	5
500	2.6	4.5
450	2.4	4
400	2.1	3.6
350	1.8	3.1
300	1.7	2.7
250	1.4	2.3
200	0.9	1.8
150	0.6	1.2
100	0.3	0.9

Setting	Low Gear	High Gear
999	5.4	9.6
950	4.8	8.8
900	4.5	8.3
850	4.2	7.9
800	3.9	7.4
750	3.8	6.8
700	3.6	6.4
650	3.3	5.9
600	3	4.5
550	2.9	5
500	2.6	4.5
450	2.4	4
400	2.1	3.6
350	1.8	3.1
300	1.7	2.7
250	1.4	2.3
200	0.9	1.8
150	0.6	1.2
100	0.3	0.9

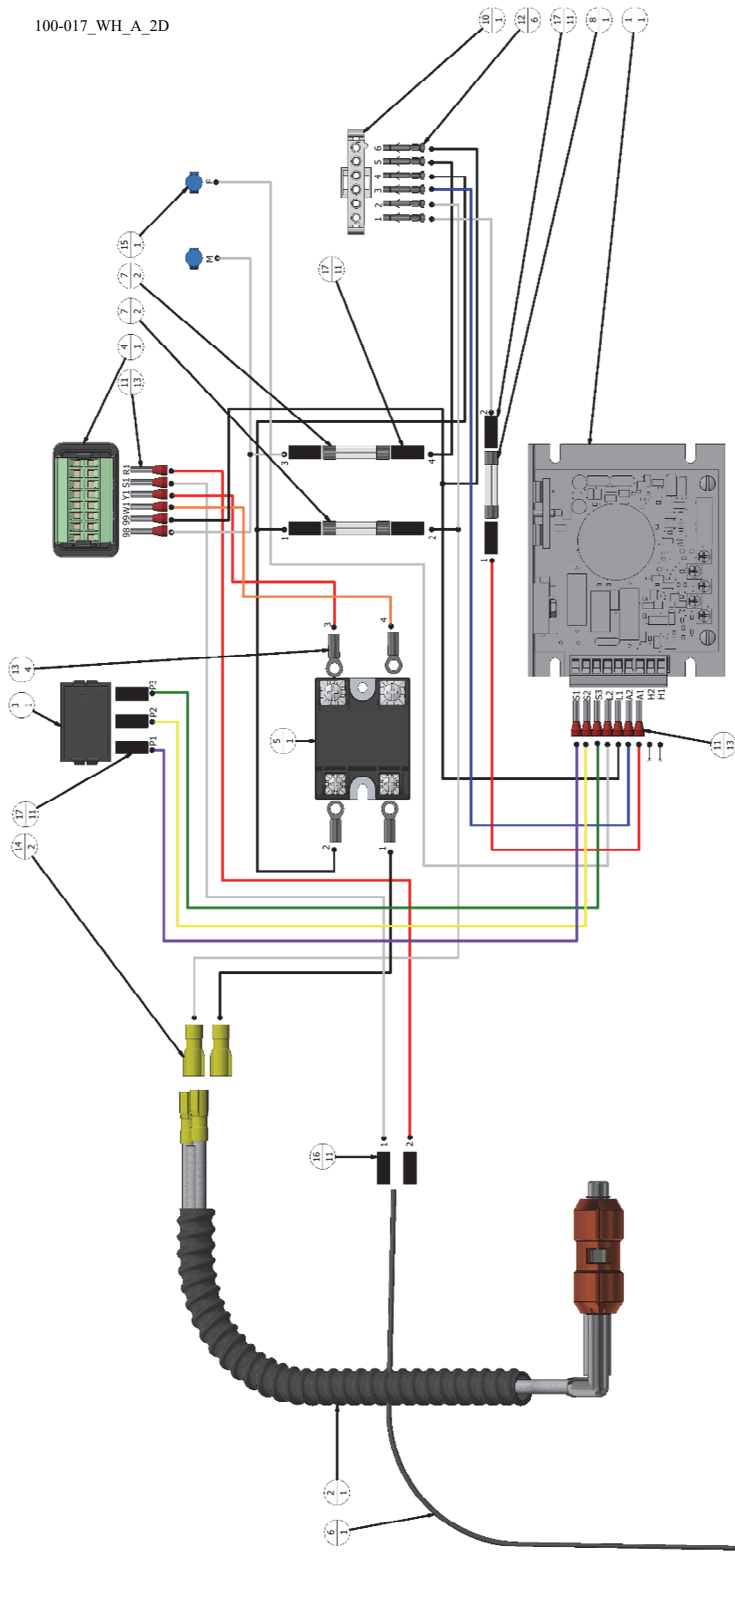


### 9.3 Appendix C, Pro-Wedge Lid Wiring Schematic (Parts ID)

PARTS LIST			
ITEM	PART NO	DESCRIPTION	QTY
1	100-415	CONTROL BOARD, MOTOR, 110V	1
2	100-160A/A	ASSEMBLY, 1 3/4" (45mm) COPPER, DUAL TRACK, 110V W/ HEATERS AND T.C.	1
3	100-416	POTENTIOMETER, PUSH BUTTON, MOTOR	1
4	100-426	CONTROLLER, TEMPERATURE, EZ-ZONE	1
5	100-431	RELAY, SOLID STATE, 25A, 3-32VDC, 240V	1
6	100-435	ASSEMBLY, THERMOCOUPLE	1
7	100-456	FUSE, 20 AMP (110V MODEL)	2
8	100-457	FUSE, 1.5 AMP	1
9	100-435	ASSEMBLY, THERMOCOUPLE	1
10	100-471	HOUSING, CONNECTOR, 6 PIN, MALE	1
11	NS-HARDWARE	FERRULE, CRIMP, 12 AWG, 10MM PIN LENGTH	13
12	NS-HARDWARE	MATE-N-LOK, SOCKET, 20-14 AWG, TIN	6
13	NS-HARDWARE	TERMINAL, RING, 16-14 AWG, 3/6" STUD	4
14	NS-HARDWARE	TERMINAL, QUICK-DISCONNECT, 12-10 AWG FEMALE, FULLY INSULATED, YELLOW	2
15	NS-HARDWARE	TERMINAL, QUICK-DISCONNECT, 16-14 AWG FEMALE, FULLY INSULATED, BLUE	1
16	NS-HARDWARE	TUBING, HEAT SHRINK, FLEXIBLE, POLYOLEFIN	11

#### ***9.4 Pro-Wedge Lid Wiring Schematic (Parts List)***

100-016\_WH\_A\_2D

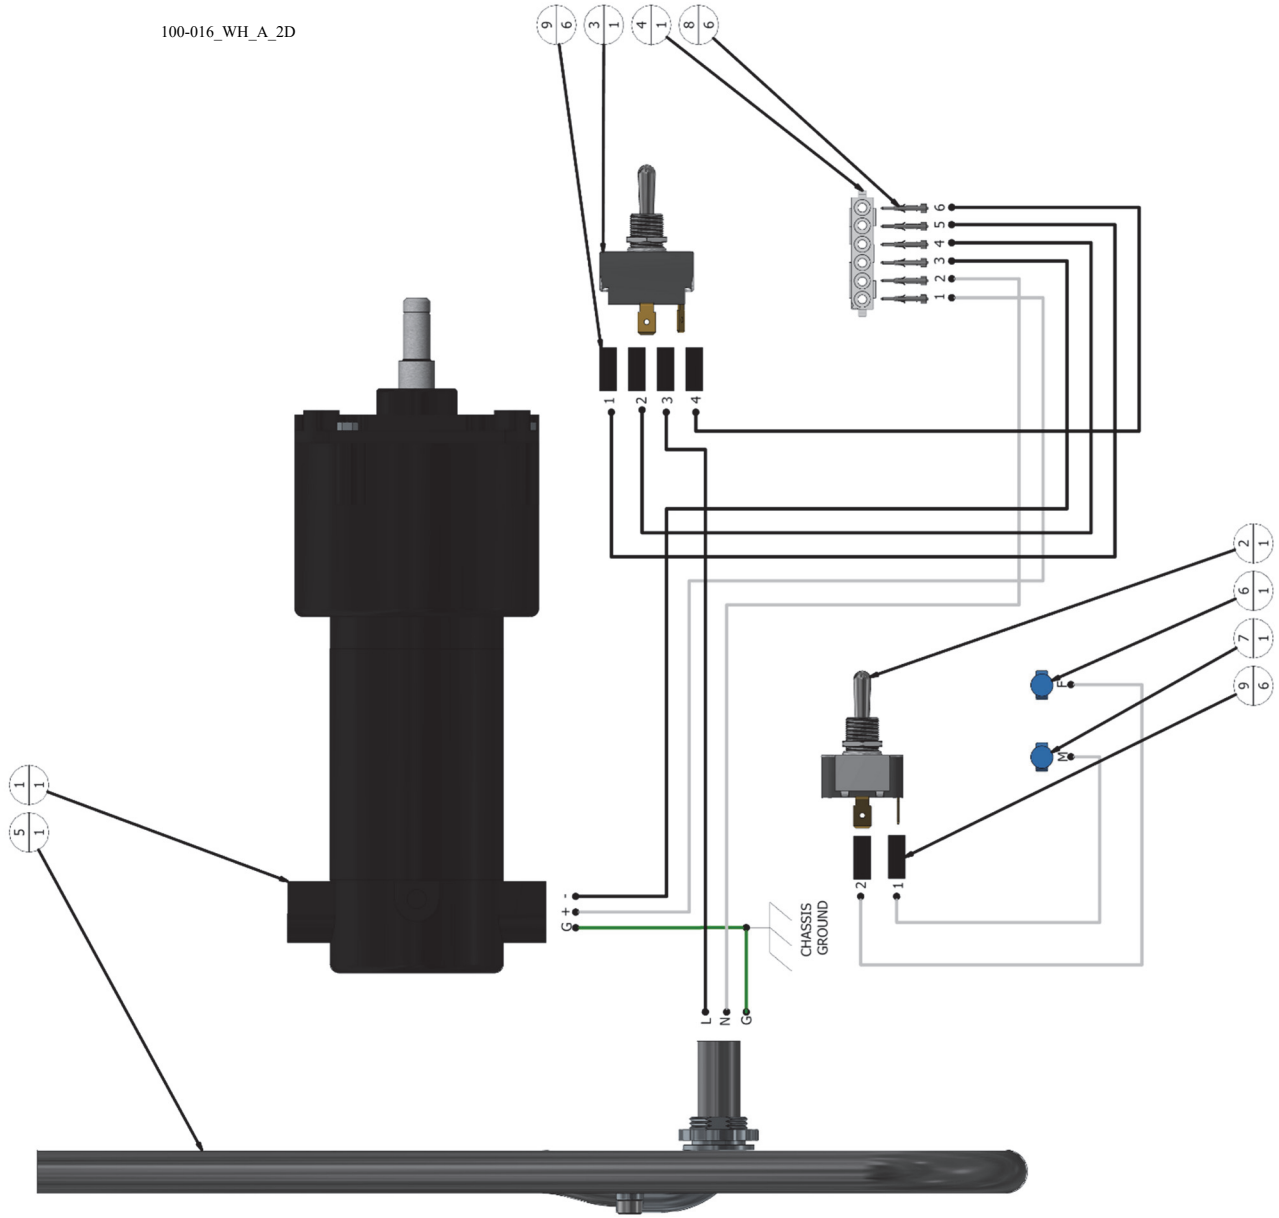

### 9.5 Appendix D, Pro-Wedge Box Wiring Schematic (Parts ID)

PARTS LIST			
ITEM	PART NO	DESCRIPTION	QTY
1	100-400	MOTOR, DRIVE, MODEL 0161, MODIFIED	1
2	100-450	SWITCH, ON/OFF, MOTOR, 2 POLE	1
3	100-450.1	TOGGLE SWITCH, ON/OFF (POWER), 4 POLE	1
4	100-472	HOUSING, CONNECTOR, 6 PIN, FEMALE	1
5	100-475/A	ASSEMBLY, POWER CORD, 120V	1
6	NS-HARDWARE	TERMINAL, QUICK-DISCONNECT, 16-14 AWG FEMALE, FULLY INSULATED, BLUE	1
7	NS-HARDWARE	TERMINAL, QUICK-DISCONNECT, 16-14 AWG MALE, FULLY INSULATED, BLUE	1
8	NS-HARDWARE	MATE-N-LOK, PIN, 16 AWG, TIN	6
9	NS-HARDWARE	TUBING, HEAT SHRINK, FLEXIBLE, POLYOLEFIN	6

### ***9.6 Pro-Wedge Box Wiring Schematic (Parts List)***

## 9.7 *Appendix E, Warranty*

# Warranty

DEMTECH Services, Inc. warrants all equipment of its manufacture to be free from defects in materials, workmanship, mechanical parts, and labor for a period of one year from the date of shipment to the original buyer and ninety days for electrical. This warranty excludes normal wear items such as gears, bearings and chains. The liability under this warranty is limited to replacement parts and labor on equipment when the equipment is returned prepaid to the factory or its authorized service center with prior authorization from DEMTECH Services, Inc., and upon examination by DEMTECH Services, Inc., is determined to be defective. At DEMTECH Services, Inc.'s option, a service representative may be dispatched to the equipment location.

As an additional protection, DEMTECH Services, Inc. warrants that for a period of 90 days from the date of shipment to the original buyer, pending prior authorization from DEMTECH Services, Inc., there will be no charge for service related shipping of parts and/or equipment or for authorized travel of a service representative to the equipment location. After 90 days, all costs incurred for shipping the equipment or parts thereof or for travel are the responsibility of the buyer. Our warranty for this equipment is rendered void if the unit has been repaired, taken apart or modified, or attempted to be, unless such actions have been taken in accordance with written instructions received from DEMTECH Services, Inc. The warranty is also void if the equipment has been subjected to abuse, accident or other abnormal conditions.

### IF ANY FAULT DEVELOPS, THE FOLLOWING STEPS SHOULD BE TAKEN:

1. Notify DEMTECH Services, Inc. by calling 1-888-324-9353. Overseas customers should contact the local DEMTECH authorized service center. Please be prepared with the model number, serial number and full details of the difficulty. Upon receipt of this information, service data or shipping instructions will be provided by DEMTECH Services, Inc. Do not return the unit for repair without first contacting the factory or its representative for instructions.
2. After the initial 90 day period, on receipt of shipping instructions, forward the equipment prepaid to the factory or its authorized service center as instructed. If requested, an estimate of the charges will be made before work begins, especially with those cases where the DEMTECH Services, Inc. product is not covered by the warranty.
3. If the original carton and packing are not available, the product should be packed in a container with a strong exterior and surrounded by a protective layer of shock-absorbing material. DEMTECH Services, Inc. advises returning the equipment at full value to the carrier.

DEMTECH Services, Inc. reserves the right to make changes in design at any time without incurring any obligation to install the same changes on units previously purchased.

This warranty states the essence of the obligations or liabilities on the part of DEMTECH Services, Inc. THE FORMAL, COMPLETE AND EXCLUSIVE STATEMENT OF DEMTECH SERVICES, INC.'S WARRANTY IS CONTAINED IN ITS QUOTATIONS, ACKNOWLEDGEMENTS AND INVOICES. DEMTECH Services, Inc. neither assumes, nor authorizes any person to assume for it, any liability in connection with the sale of its equipment other than those set forth herein.